

6825 W. Sam Houston Parkway N. (77041) P.O. Box 3826 Houston, TX 77253-3826 (713) 466-1449 (713) 466-1819 Fax www.enconsafety.com

August 15, 2016

For Immediate Release

RE: Aquarion® Activation Advisory

The eyewash nozzles should be replaced on the Aquarion[®] fluid cartridge models listed below sold from August 1, 2014 to August 1, 2016, and the fluid cartridge tubes should be repositioned. Fluid cartridges sold prior to August 1, 2014 are expired and should be replaced. This advisory does not apply to expired fluid cartridges.

AFFECTED MODELS:

AQ120 - Aquarion[®] Prefilled Fluid Cartridges AQ110 - Aquarion[®] Prefilled Fluid Cartridges

AQ111 - Aquarion® Fillable Cartridges

Eyewash nozzles manufactured before August 1, 2016 may include protrusions on either side of the piercing tube as seen below in figure 1. Open the Aquarion® tray using the release tabs on the bottom of the pull handle according to recommended procedures being careful not to puncture the foil on the Aquarion® fluid cartridge tubes. Install the replacement eyewash nozzles to allow the piercing tube to fully engage the fluid cartridges. Replacement eyewash nozzles are available at no charge from Encon. Please call Encon® Safety Products customer service representatives at 1-800-283-6266 to place your request for replacement eyewash nozzles.

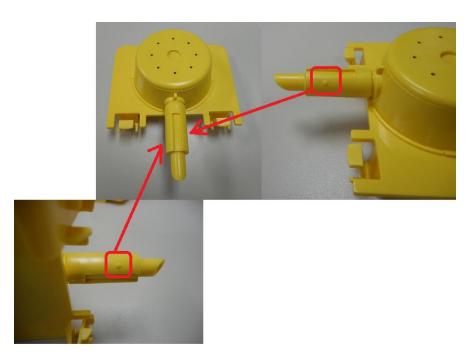


FIGURE 1 – Location of Protrusions





To ensure that there is no tension on the tubing, verify that the tubing is captured in the retaining clips and curved slightly inward between the retaining clips and the tray forks as seen below in figure 2.

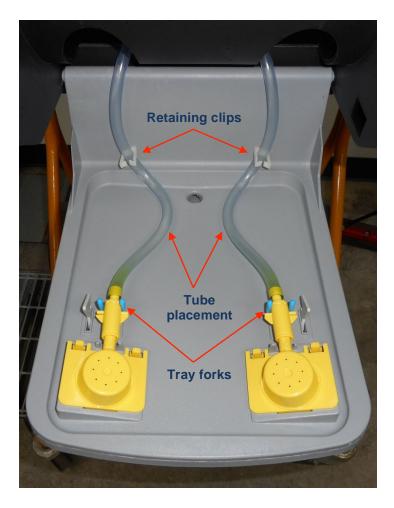


FIGURE 2 – Recommended tubing placement